
Completion Report

Homelands Housing and Infrastructure Program





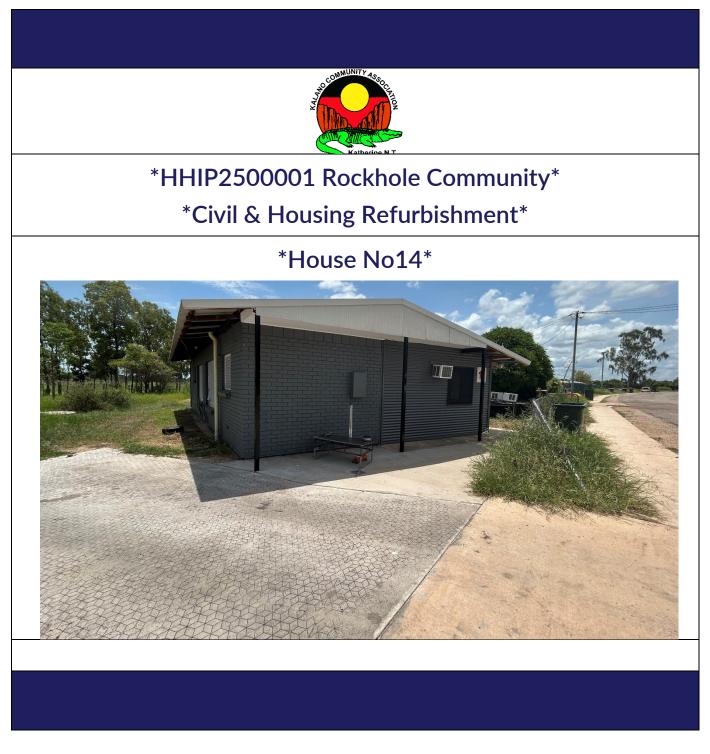

Contents

Project Summary	
Scope of Works Overview	
Visual Progress	
Attachments	
Final Review and Acceptance	Error! Bookmark not defined.

Service Provider	Kalano Community Association	ABN	17 030 032 930
Contact Details	Alan Mole (CEO) <u>ceo@kalano.org.au</u> Nashe Kasiyan (Project Manager) nkasiyan@kalano.org.au	Contractor Accreditation Limited (CAL) Registration Number:	К-3-1451-09-25
Project Name	Rockhole Refurbishment	Contract No.	HHIP2500001
Homeland	Rockhole Community	Community ID	642
Project Type	Housing upgrades	House #	14
Commencement Date	13/11/2024	Completion Date	17/12/2024 (delay due to extension works)

Project Summary

Community Association have completed the housing upgrade works to House 14 in Rockhole on behalf of the NT Government's Homelands Housing Infrastructure Program (HHIP).

The works were completed in line with the Scope of Works listed in this report. Kalano made provisions of temporary accommodation for resident, scoping of works to upgrade home to current living standards under the latest building code guidelines for electrical, ventilation, accessibility & sanitation. The aim was to ensure the home & the community met the 9 Healthy Living Principles in the NT. Kalano also organised safe & lockable container storage facility for residents while works were underway. Residents were encouraged to choose the colour of finishes they wanted in their homes during scoping consultations and any special requirements that would enhance their living experience in the home.

Menzie's Health also ran a study on works being carried out in the upgrades not just for House 14 but for all. Works to the community upgrades contributed to the Chief Ministers' Awards nomination win in 2024 for the HHIP Team



Scope of Works Overview

Homeland: House/Asset No: Scoping Date:		Rockhole Community, Florina Road, Katherine House 14 15/07/2023				
				Throu	ghout the Dwelling	
				Requir	ed Maintenance Works	
٠	Environmental Clean					
•	Repaint all internal walls, ceiling, door, do	oor frames and window frames.				
•	Repaint external walls and roof.					
•	Multiple lights (internal and external) not	t working – inspect and repair.				
•	Inspect Fire Alarms and install where mis	ssing.				
•	Install night latch on all doors.					
•	Install curtain hooks in all windows.					
•	Install Crim safe to all windows and door	r flyscreen to match where missing.				
Exteri	or					
•	Tighten existing clothes line and add ext	ra lines where missing.				
•	1 X room to be added at the front of the	house unless other suitable options available.				
Loung	ge/Kitchen					
•	Flyscreen is bent and off the window - n	eeds replacement to Crim safe.				
•	No electrical supply, inspect and repair.					
•	Replace light – missing bulb and cover.					
•	Flooring requires cleaning.					
•	Inspect smoke alarm and repair/replace a	as required.				
	No air conditioning unit in this room – in	istall.				
•						
•	Kitchen					
•	Kitchen Reinstate fly screen.					
•		eel shelves.				
• • •	Reinstate fly screen.					
•	Reinstate fly screen. Replace kitchen shelves with stainless st	vo hot plates are operational – Replace.				



Bathroom

Toilet

- Replace tiles stained and rusty.
- Leaking water inspect for any plumbing issues and repair.
- Replace Toilet bowl.

Shower

- Shower head, shower taps, and sink taps to be removed and replace with quarter turn hand levers.
- Replace tiles stained and rusty.

Laundry

- Fix wall panel for the cupboard.
- Change taps to levers.

Bedroom 1

- Reinstate fly screen.
- Reinstate fan to the ceiling, hanging loose.
- No air conditioning unit in this room install.
- Install night latch on door.

Bedroom 2

- Reinstate fly screen.
- Door handle missing reinstate; install night latch.
- Reattach fan switch to the wall.
- Replace air conditioning unit.




Bedroom 3 (New)

- Pest control and certificate
- Concrete footings. For homes on the ground concrete slab
- Galvanised steel wall frames and trusses
- Roof and ceiling batons zincalume (steel)
- Color bond fabricated fascia
- Color bond corrugated roofing
- Cyclone roof assembly screws
- Cyclone ridge assembly fixed to ridge cap.
- 8mm etherm insulations over roof area
- Powder coated black alum expanded mesh vermin proofing.
- Color bond corrugated wall cladding, screw fixed.
- Wall framing insulated with 8mm etherm.
- External wall frames insulated internally with fiberglass bats (R1.5)
- Steel door frames with 920mm wide solid core doors fitted.
- Black powder coated slider windows windows fitted with security screens.
- Ceiling insulated with fiberglass bats (R1.5)
- House lined internally with 9mm CFC walls and 6mm CFC with plastic H joiners.
- Colour bond internal corner flashings fitted over CFC
- Ceiling fan in room
- LED downlights 4 of
- Electrical provisions provided for air conditioners.
- 2 double GPO's single outlets
- Black security screens
- Black security doors 920mm wide
- All doorways fitted with 920mm wide doors.
- Box air conditioning fitted to new bedroom.



Electrical Works

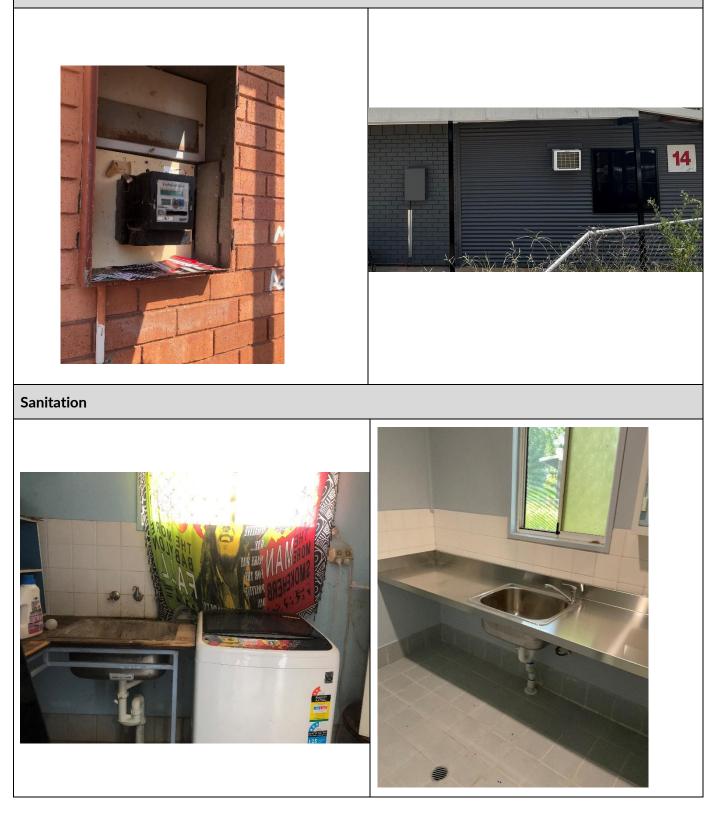


Visual Progress

Include before and after images of all areas that received upgrades. Delete/add areas as needed.



house 14 - *Rockhole Community*


Completion Report

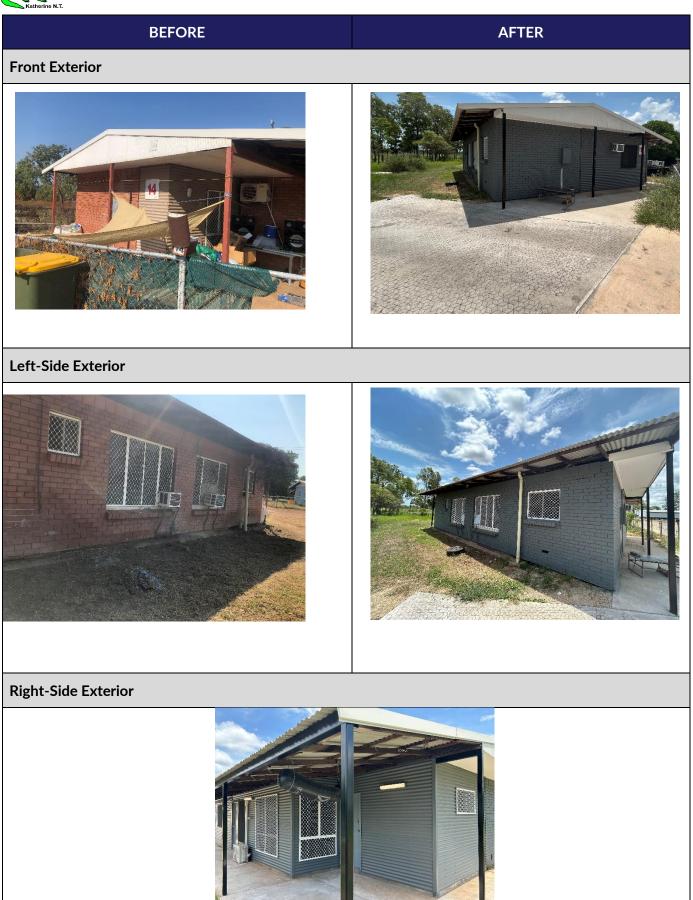

Department of Housing, Local Government and Community Development Version 1.0 – September 2024 Page 7 of 12





Living Room

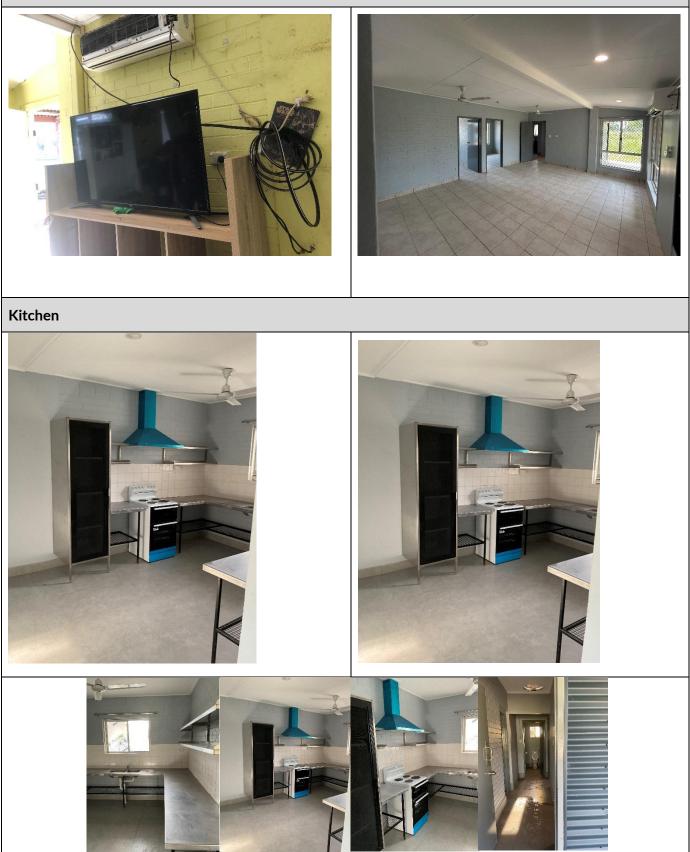



Bedroom 1

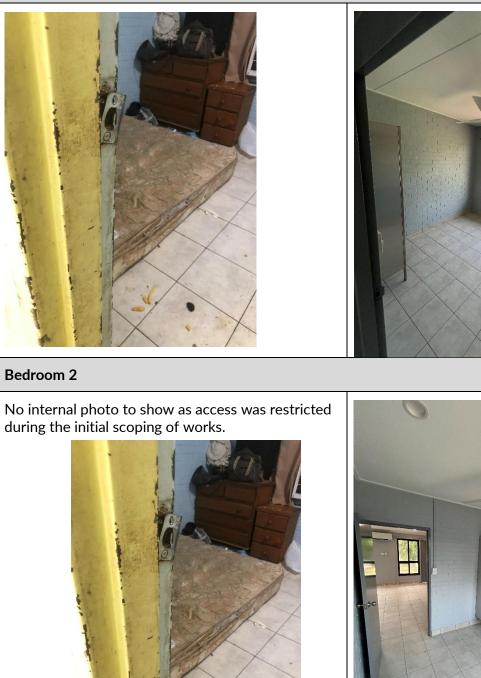

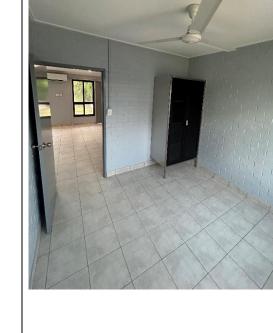




Bedroom 3 (New)





Toilet

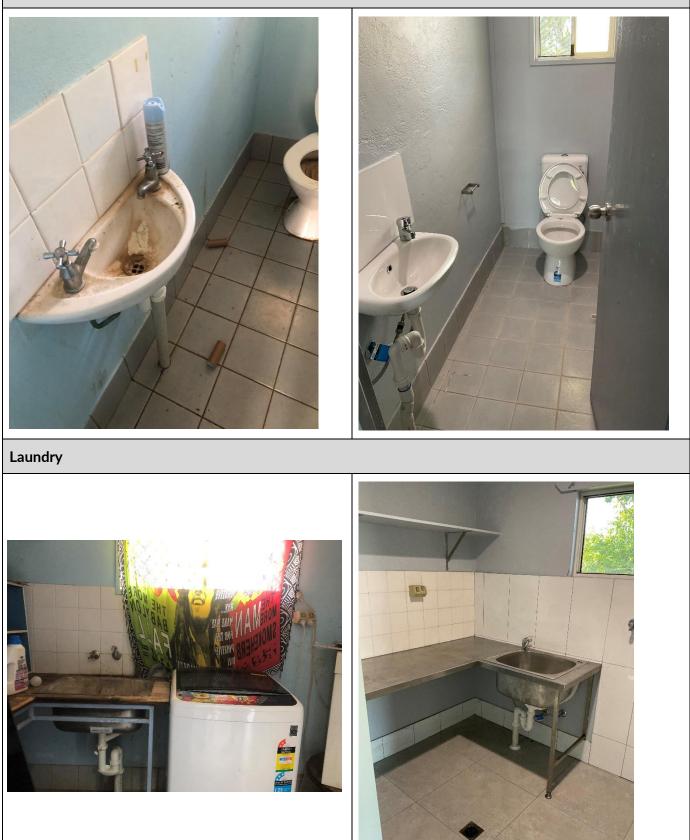

house 14 - *Rockhole Community* Completion Report



Attachments

- ✓ Electrical Certificate of Compliance
- ✓ Water Proofing Certification
- ✓ Glazing Certification
- ✓ Inspection Certificate
- ✓ Builders Declaration